


75mm Face Fix Sliding Window 1286 x 1810 XO
Test 0113 07/12/2011

Construction:

Sill WASW075
Head WASW076
Jamb WASW077
Mullion WASW039
Sliding Sash WASW005 / WASW006
Fixed Sash WASW007 / WASW008

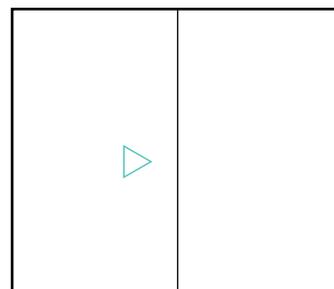

Seals:

Slider Rails / Stiles SWA009
Mullion SWA082

Glass:

6mm Clear Toughened

Results:

Test		Standard	Result
Deflection (Mullion)	Positive	AS4420.2	Span/316 @ 3007Pa
	Negative	AS4420.2	Span/281 @ 3001Pa
Operating force	Open - initiating	AS4420.3	44N
	Open - maintaining	AS4420.3	24N
	Close	AS4420.3	24N

Test		Standard	Result
Air infiltration	Positive @ 75Pa	AS4420.4	0.50l/s/m ²
	Negative @ 75Pa	AS4420.4	0.58l/s/m ²
	Positive @ 150Pa	AS4420.4	0.69l/s/m ²
	Negative @ 150Pa	AS4420.4	0.90l/s/m ²
Water penetration resistance		AS4420.5	450Pa
Ultimate strength	Positive	AS4420.6	4500Pa
	Negative	AS4420.6	9000Pa

For further details please refer to the complete test report.