


**AWNING WINDOW 1543 x 970 A**  
Test 0095 17/06/2011

**Construction:**

Sill WAAW128  
Head WAAW129  
Jamb WAAW130  
Sash WAAW125 / WAAW125

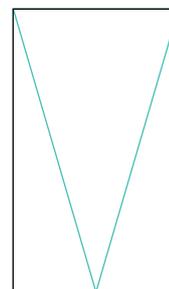

**Seals:**

Outside Seal PBD48-650  
Inside Seal SAW002

**Glass:**

6mm Clear Toughened

**Results:**

Test	Standard	Result
Deflection	Positive	AS4420.2 N/A
	Negative	AS4420.2 N/A
Operating force	Open - initiating	AS4420.3 N/A
	Open - maintaining	AS4420.3 N/A
	Close	AS4420.3 N/A

Test	Standard	Result
Air infiltration	Positive @ 75Pa	AS4420.4 0.05l/S/M <sup>2</sup>
	Negative @ 75Pa	AS4420.4 0.34l/S/M <sup>2</sup>
	Positive @ 150Pa	AS4420.4 0.06l/S/M <sup>2</sup>
	Negative @ 150Pa	AS4420.4 1.38l/S/M <sup>2</sup>
Water penetration resistance	AS4420.5	1000Pa
Ultimate strength	Positive	AS4420.6 6000Pa
	Negative	AS4420.6 6000Pa

For further details please refer to the complete test report.