


HINGED DOOR 2375 x 1500

Test 0103 04/08/2011

Construction:

Sill	WAFD111
Head	WAFD112
Head Bead	WAFD113
Jamb	WAFD112
Jamb Bead	WAFD113
Stiles	WAWF006
Rails	WAWF006
Bead	WAWF008

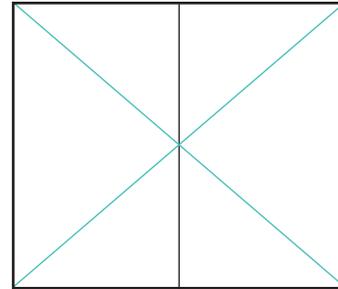

Seals:

Jambs / Sill	SFD054
Sash	SFD057

Glass:

6.38mm Grey Laminated

Results:

	Test	Standard	Result
Deflection (stile 1)	Positive	AS4420.2	Span/502 @ 1500Pa
	Negative	AS4420.2	Span/677 @ 1528Pa
Deflection (stile 2)	Positive	AS4420.2	Span/192 @ 1500Pa
	Negative	AS4420.2	Span/193 @ 1528Pa
Deflection (stile 3)	Positive	AS4420.2	Span/401 @ 1500Pa
	Negative	AS4420.2	Span/602 @ 1528Pa
Operating force	Open - initiating	AS4420.3	N/A
	Open - maintaining	AS4420.3	N/A
	Close	AS4420.3	N/A

HINGED DOOR 2375 x 1500
Test 0103 04/08/2011

Results:

	Test	Standard	Result
Air infiltration	Positive @ 75Pa	AS4420.4	0.22l/S/M ²
	Negative @ 75Pa	AS4420.4	0.42l/S/M ²
	Positive @ 150Pa	AS4420.4	0.32l/S/M ²
	Negative @ 150Pa	AS4420.4	0.66l/S/M ²
Water penetration resistance		AS4420.5	150Pa
Ultimate strength	Positive	AS4420.6	4386Pa
	Negative	AS4420.6	6105Pa

For further details please refer to the complete test report.