


**LOURVE WINDOW 2194 x 752 L**

Test 0186 16/05/2018

**Construction:**

Sill                                   WALW170  
Head                                   WALW171  
Jamb                                   WALW172  
Gallery                               Breezway Altair

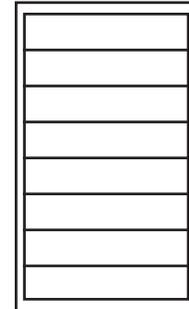

**Seals:**

Head/Sill                           SC83UV

**Glass:**

6mm Clear Float

**Results:**

Test	Standard	Result	
Deflection (Span 1)	Positive	AS4420.2	Pass
	Negative	AS4420.2	Pass
Deflection (Span 2)	Positive	AS4420.2	Pass
	Negative	AS4420.2	Pass
Deflection (Span 3)	Positive	AS4420.2	Pass
	Negative	AS4420.2	Pass
Deflection (Span 4)	Positive	AS4420.2	Pass
	Negative	AS4420.2	Pass
Deflection (Span 5)	Positive	AS4420.2	Pass
	Negative	AS4420.2	Pass
Deflection (Span 6)	Positive	AS4420.2	Pass
	Negative	AS4420.2	Pass
Operating force	Open - initiating	AS4420.3	N/A
	Open - maintaining	AS4420.3	N/A
	Close	AS4420.3	N/A

LOURVE WINDOW 2194 x 752 L  
Test 0186 16/05/2018

**Results:**

	Test	Standard	Result
Air infiltration	Positive @ 75Pa	AS4420.4	2.94l/S/M <sup>2</sup>
	Negative @ 75Pa	AS4420.4	0.70l/S/M <sup>2</sup>
	Positive @ 150Pa	AS4420.4	N/A
	Negative @ 150Pa	AS4420.4	N/A
Water penetration resistance		AS4420.5	200Pa
Ultimate strength	Positive	AS4420.6	2833Pa
	Negative	AS4420.6	2727Pa

For further details please refer to the complete test report.